

Summary	Replacing the Top Seal Wind Rib on the MT Wyndstar Carwash Door				
Products Affected	MT Wyndstar Carwash Door				
Key Word Tags	Top Seal, Replacement, Carwash, MT, Wyndstar				
Tools/Equipment (If Required)	Phillips Screw Driver, Utility Knife or Shears				
Parts/Materials (If Required)	WINDRIB, TOP SEAL, MT R1650181-0 LOCKTITE 41101 411 3GRAM BOTTLE R1210274-0 FSCS, 3/8-16UNC X 6.00LG, SS (2ea) R5550146-0Z04				
Related Media					
Author	Randy Meyer, RevA M. Burzlaff	Issue Date	3/7/2011	Status	Active

Please Read The Entire Bulletin Before Beginning The Procedure

The Rytec car wash door model MT has a seal that makes contact with the drum roll during opening and closing. This seal consists of 2 white plastic arms, 2 wheels, fiberglass wind rib, vinyl seal and miscellaneous hardware. (See Figure 1).

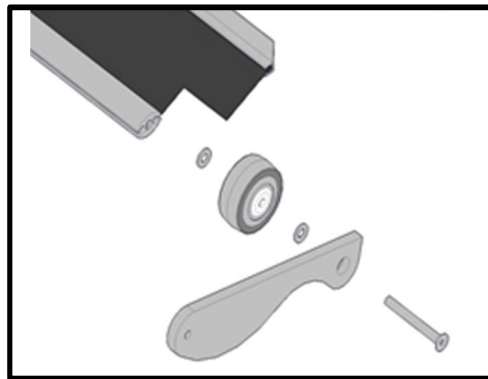


Figure 1

Removing the original seal.

1. Remove screw on each end. Throw away the screws.
2. Place wheel and washers in safe place. They will be re-used.
3. Slide the fiberglass wind rib off the vinyl seal.

Replacing new wind rib using longer screw.

1. The existing seal needs to be trimmed to fit the new, longer screw. (See Figure 2).

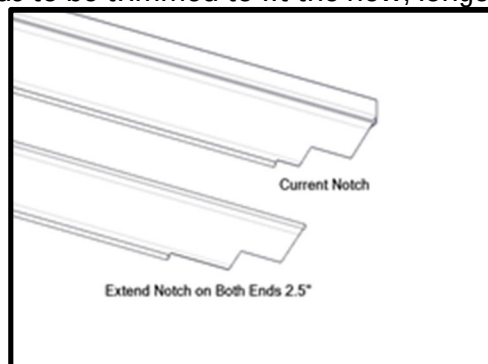


Figure 2

2. Slide the new fiberglass wind rib onto the vinyl seal. (See Figure 3).



Figure 3

3. Replace the washer and wheels on each end. Install with new longer screws applying Loctite (provided) to the screws before installation. (See Figure 4).

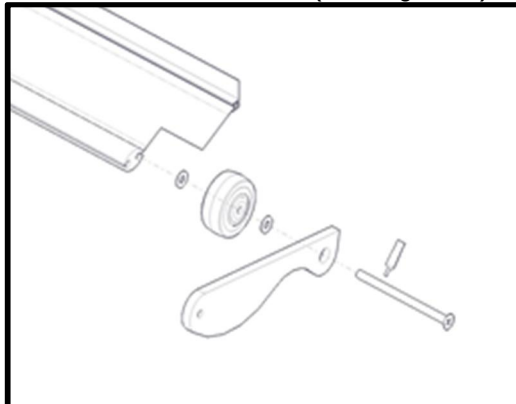


Figure 4

4. Final assembly should look like (Figure 5).

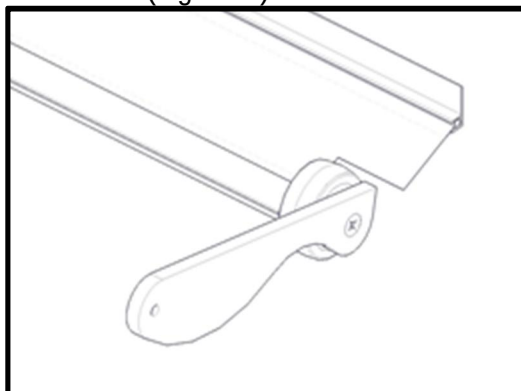


Figure 5

Please contact Rytec Customer Support at 1-800-628-1909 with any questions.