

Summary	Field Installation of Hypalon Seal Wrap				
Products Affected	TSI Gen 2 Doors				
Key Word Tags	TSI, Gen 2, Seal, Wrap, Retro, Hypalon				
Tools/Equipment (If Required)					
Parts/Materials (If Required)	K1170796-0 BRUSH SEAL WRAP - GEN2				
Related Media					
Author	Mike Burzlaff	Issue Date	10/20/17	Status	Active

Please Read The Entire Bulletin Before Proceeding

In order to help prevent cold air infiltration from the warm side to the freezer side on Turbo Seal Insulated Gen 2 doors, Rytec is implementing a wrapped header seal to better handle the temperature differentials.


The current fiberglass seal will need to be removed to install the Hypalon wrap.




WARNING

The disconnect must be in the OFF position and properly locked and tagged before Performing the next step of the procedure.


The mounting angle iron can remain on the wall. Remove the screws from the bottom of the angle iron that are holding the fiberglass in place.

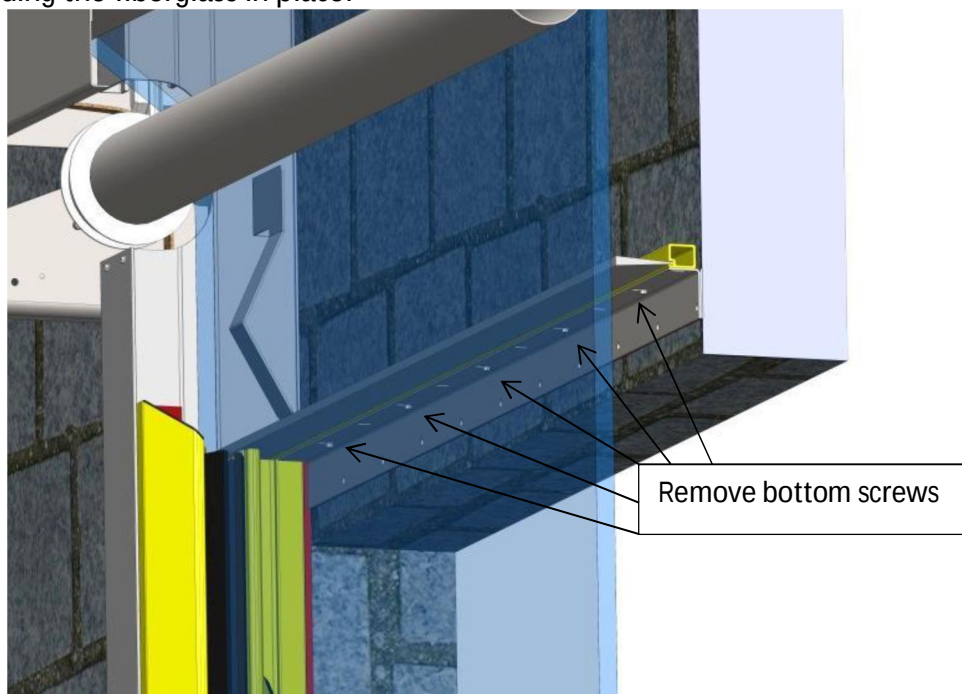

The seal is wrapped around the fiberglass and brush to create a loop. Use the provided screws to secure the brush to the top side of the fiberglass.

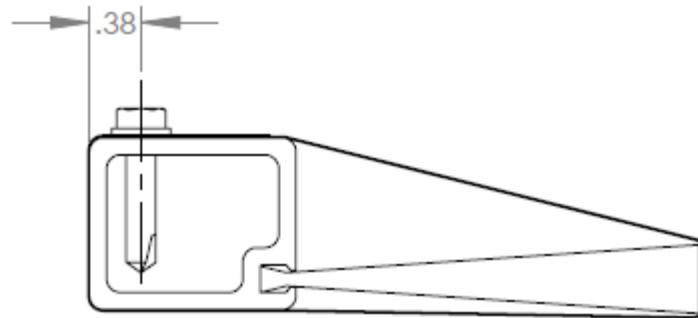

Starting at about 2 ¼" from one end of the fiberglass, space the screws every 8"-10" the length of the retainer.

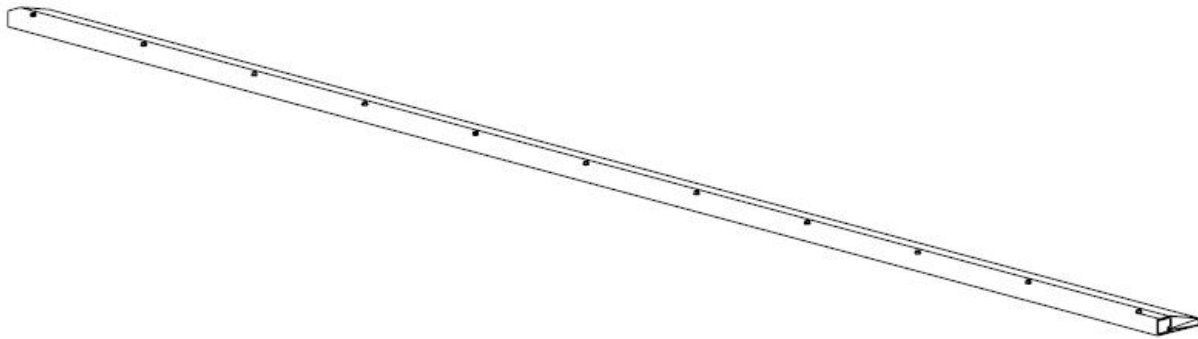

The other edge of the seal will be sandwiched between the mounting angle on the wall and the retainer.





Reinstall the wrapped seal onto the mounting angle piece.

Test the operation and slide the fiberglass in or out as needed.

If you have any questions please contact Rytec Customer Support at 1-800-628-1909.